25X1A	20 m Ol sooteem as land a		
ORIGE UNIT : 25X1AEXT : DATE:	IDEA/OSA TOP SECRET	17R0001000100 2 3 05 A	PAUSING DACIA
7O :	AFSSO USAF JCS WASH, D. C.	4 005A 5 01A 6 TATE 7 DX +T	12 C C C C C C C C C C C C C C C C C C C
FROM: CONF:	DIRECTOR	8 // DEFERRED	PRIORITY PRITALS
INFO:		ROUTINE:	OPERATIONAL INITIALS  IMMEDIATE
<b>TO</b> .	OSA 1-	2000	06521
25X1A	TOP SECRET. CHANNELS. PROJE		JCS PASS
	TO J-3 JRC, AFSSO PASS TO AFXOPR FOR INFO.	CITE OPCEN	547

- 1. THIS MSG IS FOLLOW-UP ON REF IN ATTEMPT TO KEEP YOU CURRENT ON INVESTIGATION OF U-2 ACCIDENT AT EDWARDS AFB. THE FOLG IS UNOFFICIAL AND SHOULD NOT BE CONSIDERED CONCLUSIVE OR CAUSE SPECULATION AS TO THE FINAL ANALYSIS OF THE ACCIDENT.
- 2. THE APPROX SCENE OF THE ACCIDENT IS 35NM NORTHWEST OF EDWARDS AFB, IN A VERY ROUGH AND HILLY AREA. DUE TO INCLEMENT WEATHER (SNOW, RAIN AND POOR VISIBILITY), ONLY SMALL PORTIONS OF THE ENGINE WING HAVE BEEN FOUND. THE WRECKAGE IS SPREAD OVER QUITE A LARGE AREA DUE TO THE ALMOST TOTAL DISINTEGRATION IN THE AIR.
- 3. FOLG ARE THE GENERAL RUNDOWN ON THE U-2 PILOT'S AND THE KC-135 CREW'S STATEMENTS:
  - A. THE PILOT HAD COMPLETED NINE DRY HOOKUPS AND THE FINAL HOOKUP WAS A PRACTICE EMERGENCY BREAKAWAY CALLED BY THE U-2

TOP SECRET

culomotic he sad

AUTHENTICATING OFFICER

REF:

OPCEN 5334

TO	l à	VEO								ATE			
PAGI	E TWO										<u></u>	0652	/
INFO:								MOM		ROUTINE		OPERATIONAL IMMEDIATE	INITIALS
CONF:								- anomo		DEFERRED		PRIORITY	INITIALS
FROM:								8				6	
								7				5	
TO :								6	-			4	
DATE:								= 4 5	<b> </b>			12	
EXT: DATE:		<u></u>			-			3		······································		1	
UNIT :		T.	O P	SE	C	RE	T	2				0	
ORtG5:	* Approved For Reje	ase zu	02/00/	15.0	TH'T	COPT	4000	##/*	200	<del>01000100</del> 1	1-3	9	NO MENT MANAGEMENT CONTRACTOR
	Approved For Rele	CL	ASSIF	[ED]	MES	SAAG	E	4430	200	010001001	क्राध्य	ING	elijani in esperanta mineapla
		CL	ASSIF	IED I	MES	SSAG	ίĒ		-	· <del></del>	OUT	EMPLEMENT OF THE PARTY OF THE P	

PILOT AND EXECUTED SMOOTHLY. ALL MEMBERS OF THE TANKER CREW WERE MOST COMPLIMENTARY ABOUT THE U-2 PILOT'S ABILITY FOR INFLIGHT REFUELING. IT WAS SIGNIFICANT THAT THE PILOT WAS ABLE ON SEVERAL OCCASIONS TO EFFECTIVELY HOOKUP WITH THE TANKER WITH NO ASSISTANCE FROM THE BOOM OPERATOR. THIS MANEUVER IS ACCOMPLISHED BY THE BOOM OPERATOR POSITIONING THE REFUELING BOOM AND MAINTAINING A CONSTANT POSITION AND THE REFUELING ACFT MANEUVERING TO A POINT AND AFFECTING THE HOOKUP.

B. UPON EXECUTION OF THE PRACTICE EMERGENCY BREAKAWAY, THE PILOT DROPPED DOWN AND BACK OF THE TANKER IN THE PROPER POSITION, MOVED TO THE RIGHT SIDE OF THE TANKER APPROXIMATELY 200 FEET AND PULLED UP FORWARD OF THE TANKER WING EVEN WITH THE COCKPIT. HE WAS THEN FLYING A LOOSE FORMATION AND PASSING COMMENTS WITH THE TANKER CREW AND WAVED AS HE THEN EXECUTED HIS DEPARTURE MANEUVER. ALL TESTIMONY AT THIS POINT BY BOTH THE PILOT AND THE TANKER CREW DENIES ANY POSSIBILITY THAT THE U-2 WAS EVER SUBJECTED TO JET WASH OR WING WASH FROM THE TANKER ACFT. HE

RELEASING OFFICER

TOP SECRET

GROUP 1 Encluded from mulamatic developming and declassification

AUTHENTICATING OFFICER

OR!G	Approved For Rele	ase 20	02/06	/18:-	GIA-	KDF	2/4B00/	17	200	010001001	7:33.	9	THE REST. HEREWAY AND THE REST.
JNIT #		TC	P	SE	C	R 1	E T	2				0	territoria de la como de la como
TXT					-	·		3			1	1	rate dia mendidakan pendia rapi bipu
DATE:								4	-		1	2	
70 :		<b></b>			******			5		-	1	3	
								6			1	4	
FROM:								7		· · · · · · · · · · · · · · · · · · ·		5	
								8	-			6)	DOTAL:
CONF:								#0P3		DEFERRED	l	PRIORITY	IN(T.AL)
INFO #								mn:mo		ROUTINE		OPERATIONAL IMMEDIATE	INITIALS
PAGE TI	IREE										2	652	
TO	1N	======== FO								~1 ~ ce			

FURTHER DENIED THAT THE BREAKAWAY MANEUVER WAS VIOLENT IN ANY WAY. THE SPEED OF THE RECEIVER IN FORMATION WAS APPROX 210 KNOTS INDICATED AIR SPEED AT 35,000 FRET.

C. AT APPROX 216 KNOTS THE PILOT EXECUTED A PULL UP FROM
THE TANKER AND A RIGHT TURN WHICH PROBABLY PUT HIM IN AN ATTITUDE
OF APPROXIMATELY 20° CLIMB ANGLE AT 20 TO 25° BANK ANGLE. THIS
MANEUVER APPEARS TO HAVE BEEN TWO MANEUVERS BEGINNING INITIALLY
WITH THE CLIMB WITH THE TURN FOLLOWING. THE INITIAL CLIMB
APPEARED TO ALL OBSERVERS TO BE PERFECTLY NORMAL AND THE
STANDARD DEPARTURE USED BY MOST U-2 PILOTS AFTER PRACTICE
REFUELING. THE ONLY ITEM NOTED IN THE CLIMB WAS A BEGINNING
OF WHAT APPEARED TO BE A FUEL VENT OR LEAK ON THE LEFT SIDE OF
THE ACFT FORWARD OF THE TRAILING EDGE OF THE WING AND REAR OF THE
WING BOOT. THE TANKER CREW INITIALLY ASSUMED IT TO BE A NORMAL
VENT OF FUEL AND WERE NOT CONCERNED. ANY BETTER DEFINITION OF
THE FUEL LEAK WILL HAVE TO AWAIT THE INVESTIGATOR'S REPORT. AS
THE U-2 INITIATED THE RIGHT TURN, THE CO-PILOT AND THE NAVIGATOR

PELEASING OFFICER

TOP SECRET

GROUP P
Excluded from enformed downgreeding and declaration for the period of the peri

AUTHENTICATING OFFICER

		Approved For Rele	ase 20	<b>A052</b> 30	)B/E8	3): <b>(</b>	AES	RIDE	<b>7</b> 4B00	<b>4</b> 47	R00	001000100	67-3	NG	na and a second
ORIG.: UNIT:	*		41 (	ם כ	g	ĸ	~	R E	ers	1 12			-	9	agi yandin ayan aya i a aa a yahadhaada
EXT :										3			1		
TO :									· · · · · · · · · · · · · · · · · · ·	5 6 7			1	4	ernagilik asuatra, dapit da antikkang m
FROM:										8				5 6 C	i entants
CONF:										ORORA		DEFERRED		PRIORITY	
INFO:										MOZON		ROUTINE		OPERATIONAL IMMEDIATE	initials
e-main management sign beautystern was	PAGE	FOUR				<del></del>							2	)65 8	1/
7/7		141	E()									CITC			

TO INFO CITI

WERE BOTH WATCHING HIS ACFT AND BOTH STATED THAT THEY OBSERVED A SEPARATION OF THE LEFT WING AT THE WING ROOT. THE ENTIRE WING THEN APPEARED TO FALL BACK TOWARD THE ACFT AND SEPARATED AND DEPARTED APPARENTLY OVER THE TAIL. AT THIS POINT THE ACET APPEARED TO ASSUME AN ATTITUDE OF APPROXIMATELY 600 CLIMB ANGLE AND THE RIGHT WING DISINTEGRATED. NO OBSERVATIONS WERE MADE OF THE TAIL. HOWEVER, AT THE SAME TIME THE WING DISINTEGRATED THE ENTIRE ENGINE FLOATED PAST THE EC-135. IN THE OBSERVERS TERMS "THE ENGINE WAS BARE". THEY WERE CLOSE ENOUGH TO BE ABLE TO IDENTIFY THE COLOR OF THE LINER AND DISCUSSED IN DETAIL THEIR ABILITY TO SEE LINES AND FITTINGS ON THE ENGINE. THIS APPEARED TO BE CLOSE ENOUGH THAT THE CO-PILOT WAS INITIALLY CONCERNED THAT IT MIGHT FALL ON THE TANKER. AT THIS POINT THE DESCRIPTION SEEMS TO BE THAT THERE WERE ONLY TWO MAJOR PORTIONS OF THIS ACFT THE FIRST BEING THE ENTIRE LEFT WING AND THE SECOND OBSERVED. BEING THE ENGINE. THE CO-PILOT FELT THAT HE HAD OBSERVED THE COCKPIT SECTION BUT WAS UNABLE TO IDENTIFY IT. THEIR AGREED

TOP SECRET

CECUP & Communication Communication Communication Condition Condition Condition Condition CECUP & CECU

AUTHENTICATING OFFICER

DATE:  TO:  FROM:  CONF:  INFO:  PAGE FIVE  TO	PRIORITY  OPERATIONAL INITIALS  IMMEDIATE  D652
TO : 5 6 7 8 CONF: DEFERRED	14 15 16 PRIORITY OPERATIONAL INITIALS
TO: 5   5   6   7   7   8   CONF: DEFERRED	14 15 16
TO : 5 6 FROM: 7	14 15
TO :	14
TO :	
4	1131
0/1 Lo	12
	111
TOP SECRET	10
INIT.	9
ORIGO Approved For Release 2002/06/18 : CIA-RDP74B00447R0001000100179	Management and property commendes to be an extension of the second second

DISCRIPTION IS THAT THE ACFT LITERALLY CAME INTO THOUSANDS OF PIECES AND THEY DESCRIBED THE SCENE AS TWO MAJOR PIECES AND THE REST OF THE ACFT APPEARED AS DEBRIS. THE TANKER CREW STAYED ON THE SCENE, FIXED THEIR POSITION AND ORBITED UNTIL RELIEVED BY HELICOPTERS. ALMOST IMMEDIATELY AFTER THE DISINTEGRATION, THE BOOM OPERATOR SAW THE PILOT STILL IN THE SEAT BUT SEPARATED FROM THE ACFT. THE PILOT DISAPPEARED FROM THE BOOM OPERATOR'S VIEW BEFORE THE CHUTE OPENED.

2. THE U-2 PILOT WAS PICKED UP BY HELICOPTER SHORTLY AFTER THE ACCIDENT AND SUFFERED MINOR CUTS, SCRATCHES AND BRUISES.

## KND OF MESSAGE

